

## 8.0 Errata Sheet

The ERRATA sheet tracks known issues that we have been made aware of and whether or not they have been fixed as firmware changes are made. Other information may also be included if it appears to meet the needs of our customers.

FIRMWARE REV7 – “Restore Default” command and external restore command does not work. **Work Around:** If serial communication is possible you can write correct register values to the Motion Mind. Or upload new firmware into device and perform external restore default. Fixed in firmware REV8.

FIRMWARE REV7 to REVA – The highest 6 bits of the FUNCTION are cleared before loading the data into EEPROM with the STORE command in ASCII communication mode. **Work Around:** Using the WRITE command on power up, or switching to binary communication mode may act as a work around for this. Fixed in firmware REVB (decimal 11) that can be uploaded to the MOTM2 using the bootlader.